1900~1970nm High Power 3-port PM Optical Circulator

FEATURES

- High Isolation
- Low Insertion Loss
- **Epoxy-Free Optical Path**
- High Reliability and Stability
- Low Profile Packaging

APPLICATIONS

- Fiber Optic Amplifiers
- Fiber Optic Instruments
- **WDM Systems**
- **Dispersion Compensation**
- **Light Routing**


SPECIFICATIONS


Parameter		Unit	А Туре	В Туре	С Туре	
Working Wavelength (λ)	nm	1900±10, 1930±20, 1950±20, 1970±20				
Insortion Lane 2200	(Typ.)	dB	1.8	1.5		
Insertion Loss@23°C	(Max.)	dB	2.5	1.9		
Jackson @ 220C	(Typ.)	dB	32	16		
Isolation@23°C	(Min.)	dB	28	14		
Extinction Ratio	dB	≥18				
Optical Return Loss	dB	≥45				
Cross Talk	dB	≥40				
Work Mode	S Type	-	Can only work in slow axis			
Work Mode	F Type	-	-	Both Axis Working		
Fibor Typo			PM1550 Panda Fiber or PM1950 Fiber (V)			
Fiber Type		_	10/130um PMDC Fiber (O) or 25/250um PMDC Fiber (R)			
Fiber Tensile Load	N	5				
Maximum Optical Power (W	1, 2	1, 2			
Operating Temperature	°C	0~50				
Storage Temperature	°C	-20~75				
Package Stai	nless Steel Tube (SST)	mm	^ø 5.5x	^L 35	See Drawing	
Dimension	Metal Box	mm	^L 120x ^W 1	2x ^H 10		

Note: 1. Specifications are for device without connectors; Specifications may change without notice.

- 2. To add connectors, IL is 0.3dB higher, RL is 5dB lower, ER is 2dB Lower, Connector key is aligned to slow axis.
- 3. Only guarantee 1W continuous wave (CW) power thru testing for connectors added.
- 4. Devices for higher optical power or with other type fiber or consigned fiber are also available; Devices can only work in the core of Double Cladding (DC) Fiber, Cladding Power must be stripped before connecting the device.
 - 5 Package size may be different for different optical power and fiber types

PACKAGE DIMENSION (C TYPE)

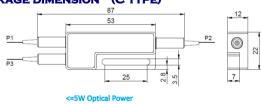

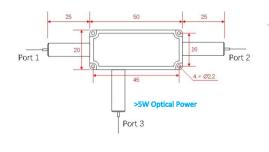

Compliant

ORDERING INFORMATION (PN)

FPCR- NNNN	- (C)	3(C) -H	P NN	- (NN)	-(C)	C	C	NN	-CC/CCC				
Center Wavelength	Work Mode	Туре	Optical Power	Average Power P2	Package	Fiber Type	Fiber Sleeve	Fiber Length	Connector Type				
1900- 1900nm	F=F Type	A=A Type	1- 1W	1- 1W	M=Metal Box	2= PM1550 Fiber	B= Bare Fiber	<mark>05=</mark> 0.5m	N=Without Connector				
1930- 1930nm	<i>Blank</i> for S Type	C=C Type	2- 2W	2= 2W	<i>Blank</i> for SST	V= PM1950 Fiber	L= Loose Tube	10=1.0m	FC/APC=FC/APC Connector				
1950= 1950nm		<i>Blank</i> for B Type	5=5W	5=5W	or C Type	0= 10/130 PMDC Fiber	2=2mm Cable	15=1.5m	LC/PC =LC/PC Connector				
1970- 1970nm		or C Type(>2W Power)	10-10W	<i>Blank</i> for P2=P1		R=25/250 PMDC Fiber	3=3mm Cable	20=2.0m	SC/UPC-SC/UPC Connector				
									RoHS				